

NELSON™ HEAT TRACING SYSTEMS

ALT-L SERIES END OF CIRCUIT LIGHT KIT

INSTALLATION INSTRUCTIONS


DESCRIPTION

The ALT-L Series End of Circuit Light Kit is constructed of aluminum. For use with all versions of LT, CLT, HLT and NC heater cables. Compatible for use with any vendor's heater cables smaller than 11mm (.44") diameter.

KIT CONTENTS

1 Junction Box	1 Power Termination
1 Conduit Locknut	1 Box Adapter
1 Sealing Grommet	1 Gasket
1 Stand-off	1 Tube of Silicone
1 Ground Screw	2 Pipe Clamps
1 Light Assembly	1 Piece of Shrink Tube
1 Caution Label	

Voltage	Kit Cat. #
120V	ALT-L120
208V	ALT-L208
240V	ALT-L240
277V	ALT-L277

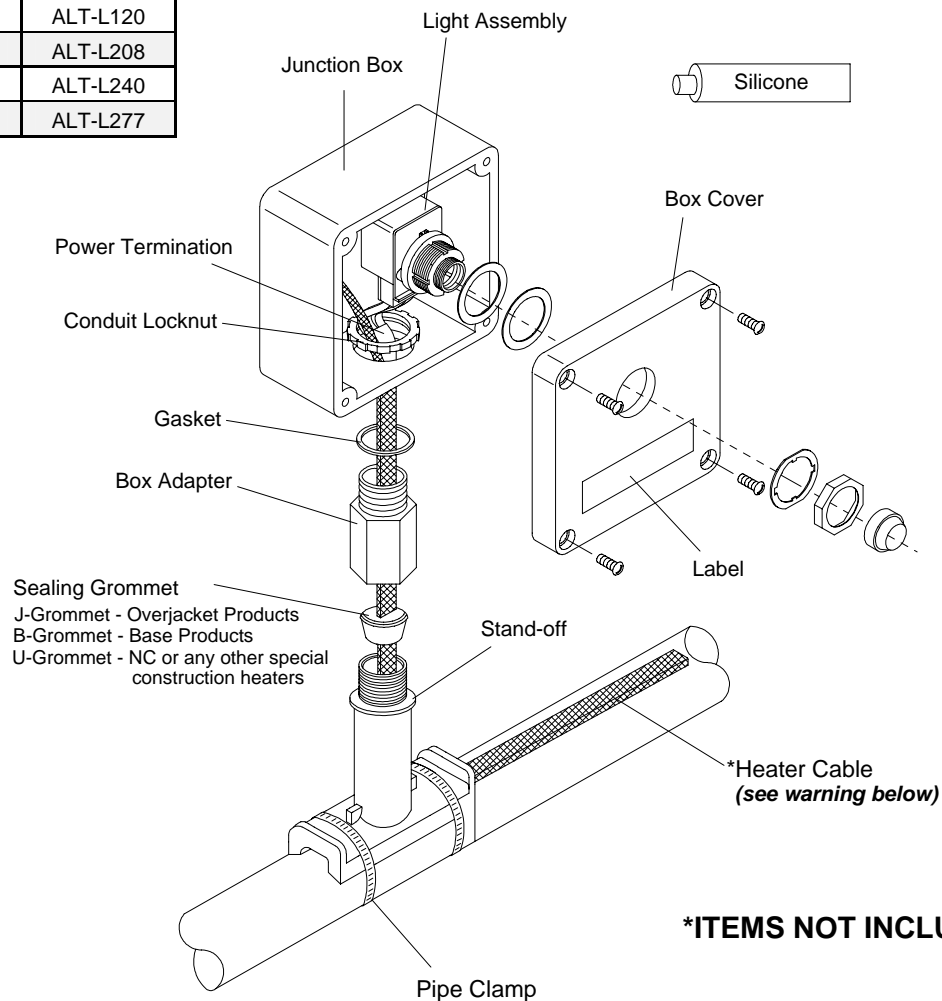

Note: For internal grounding of braid see sheet 8.

WARNING:


Article 427-22 of the National Electrical Code requires that all heaters shall have metal coverings and be provided with branch circuit ground-fault protection.

NELSON™ HEAT TRACING SYSTEMS

ALT-L SERIES END OF CIRCUIT LIGHT KIT


INSTALLATION INSTRUCTIONS

STAND-OFF POSITIONING

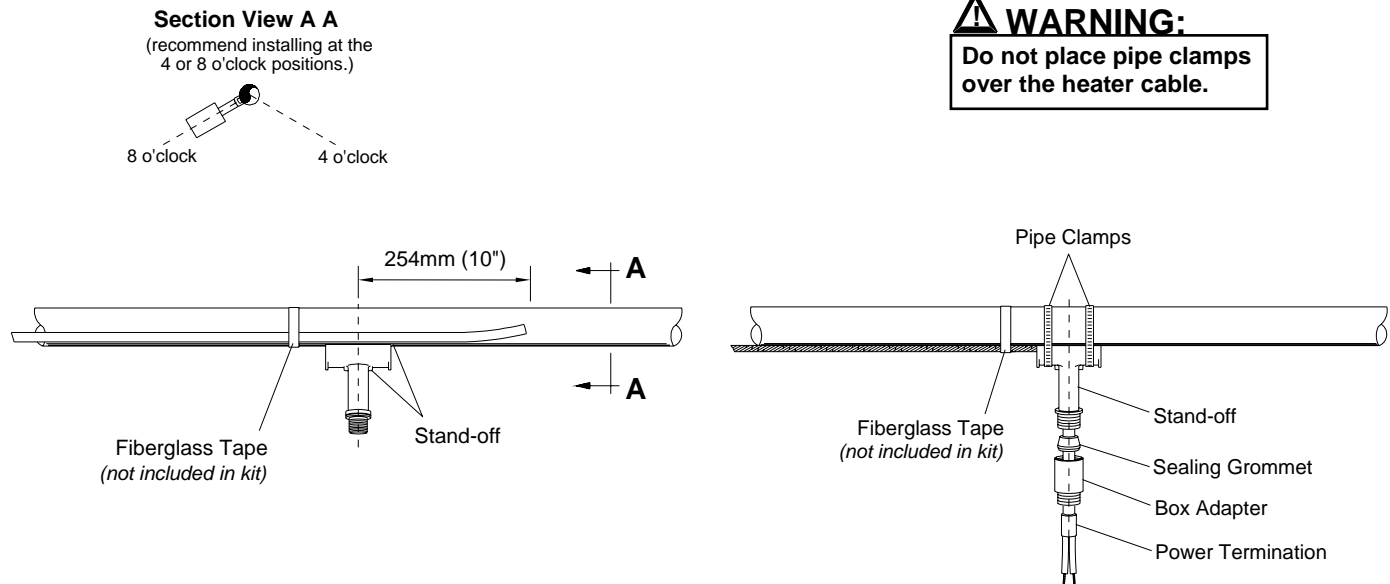


- ❶ Mark pipe where stand-off will be mounted.
- ❷ Push heater cable through bottom opening of stand-off.
- ❸ Slide the sealing grommet over the heater cable and position inside stand-off opening:
for Braided "CB" Products:
See "Grommet Installation for Braided "CB" Products", sheet 3.
for Overjacket "J" or "JT" Products
Proceed with step 4 below.
- ❹ Apply silicone around the heater cable on top of the sealing grommet and fill any voids in sealing grommet.
- ❺ Slide the box adapter over the heater cable and tighten securely to stand-off.
- ❻ Prepare heater cable for power termination:
for Braided "CB" Products, see sheet 3.
for Overjacket "J" or "JT" Products, see sheet 4.
- ❼ Terminate heater cable, see sheet 7.

SEALING GROMMET INSTALLATION FOR BRAIDED “CB” PRODUCTS

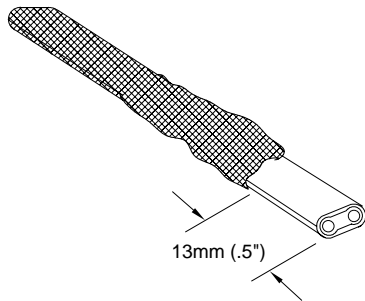


- ❶ Slide braid back, allowing at least 13mm (.5") of heater cable exposed.
- ❷ Cut and remove 13mm (.5") of heater cable.

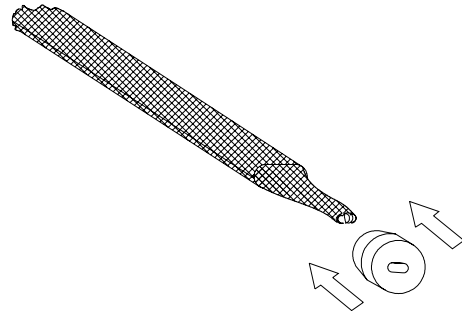


- ❸ Slide braid back over heater cable and twist excess braid into a pigtail.
- ❹ Slide the sealing grommet over the heater cable and position inside stand-off opening.
- ❺ Continue with step 4 on sheet 2.


BRAIDED “CB” PRODUCTS

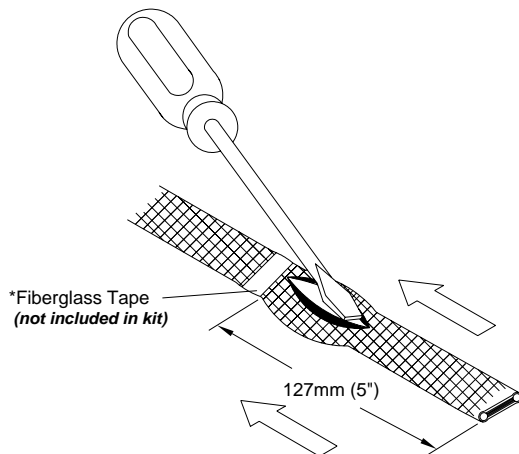

- ❶ Secure cable braid with fiberglass tape.
- ❷ Slide braid back 127mm (5") to create a bulge.
- ❸ At the bulge, separate the braid to make an opening.

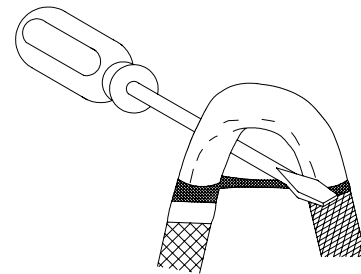

- ❹ While bending the heater cable, work it through the braid opening.

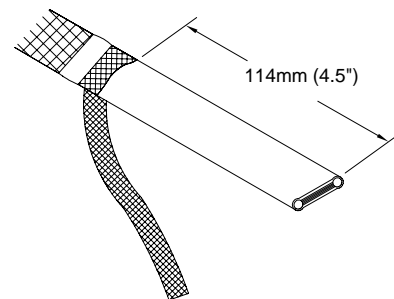


- ❺ Pull the braid tight,
- ❻ Proceed to “LT, CLT & HLT Products”, sheet 5

NELSON™ HEAT TRACING SYSTEMS

ALT-L SERIES END OF CIRCUIT LIGHT KIT


INSTALLATION INSTRUCTIONS

OVERJACKET "J" or "JT" PRODUCTS

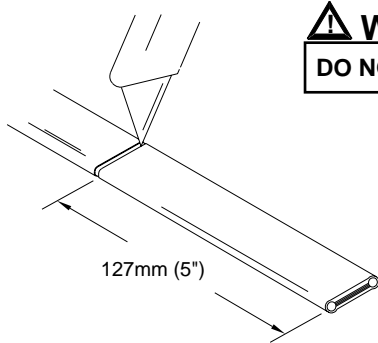


⚠ WARNING:
DO NOT CUT BRAID


- ❶ Lightly cut around cable overjacket 127mm (5") from the end. Bend cable to break the overjacket.
- ❷ Lightly cut overjacket up the center between first cut mark and the cable end. Bend cable to break the overjacket.

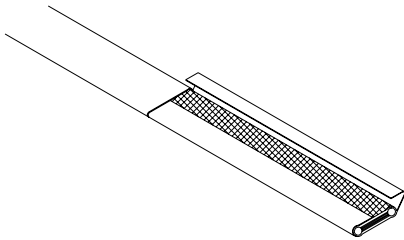


- ❸ Remove overjacket from heater cable.

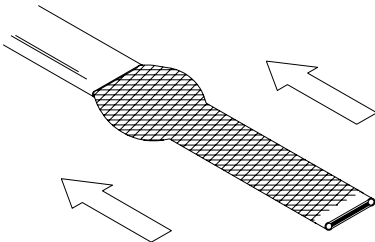


- ❹ Move braid back toward the overjacket, creating a bulge.

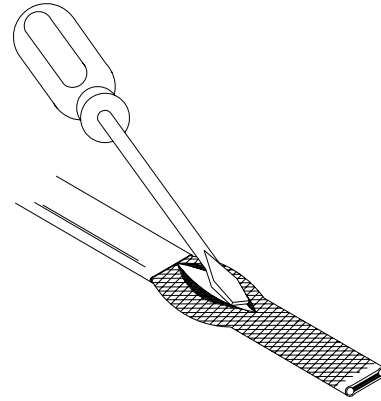

- ❺ At the bulge, separate the braid to make an opening.

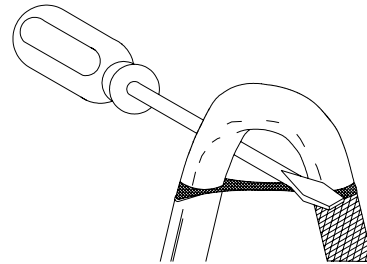

- ❻ While bending the heater cable, work it through the braid opening.

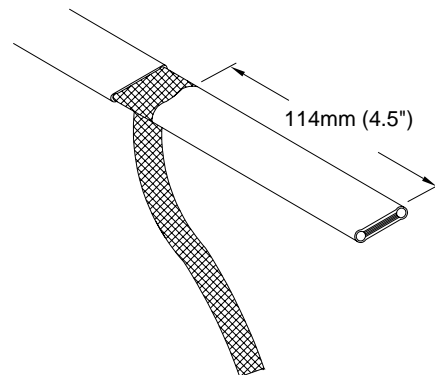

- ❼ Pull the braid tight.
- ❽ Proceed to "LT, CLT & HLT Products", sheet 5.


NELSON™ HEAT TRACING SYSTEMS

ALT-L SERIES END OF CIRCUIT LIGHT KIT


INSTALLATION INSTRUCTIONS

FOR ALL NELSON LT, CLT & HLT PRODUCTS


(See sheet 6 for an alternate stripping method for HLT products.)

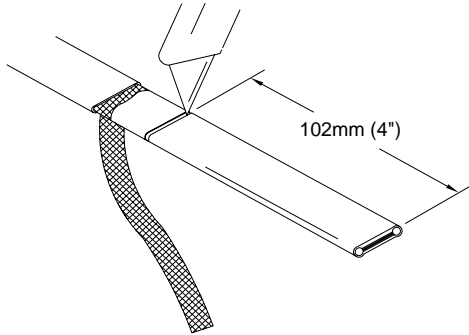


- ❶ Lightly cut around cable outer jacket 102mm (4") from the end. Bend cable to break outer jacket.
- ❷ Lightly cut the outer jacket up the center between the first cut mark & the cable end. Bend cable to break outer jacket.

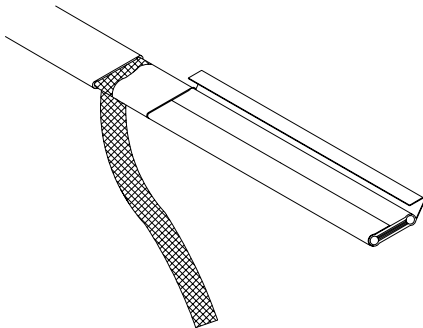


- ❸ Remove the jacket from the heater cable.

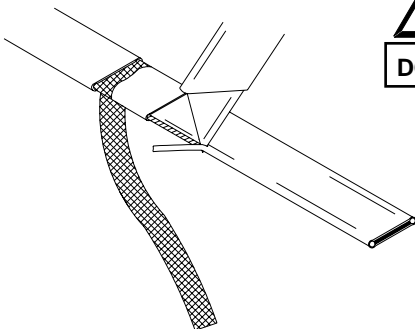

- ❹ Shave the core material from the outside of each bus wire.

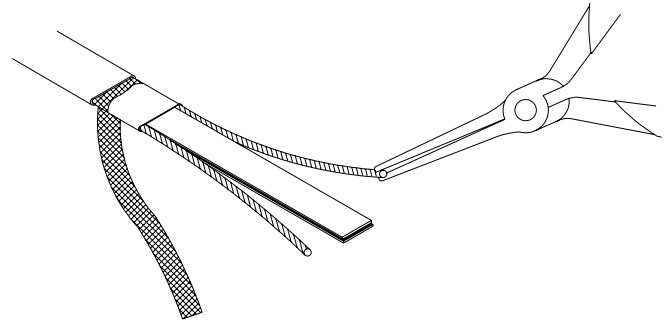

- ❺ Starting at the end, pull each bus wire away from the core material.
- ❻ Remove exposed core material.

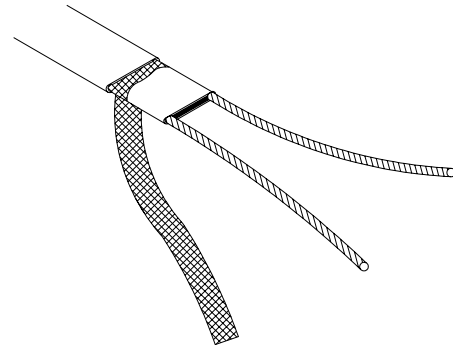

- ❼ Cut 6mm (0.25") off the end of each bus wire.
- ❽ Proceed to "Power Termination", sheet 7.


⚠ WARNING:
DO NOT CUT BUS WIRES

NELSON™ HEAT TRACING SYSTEMS


ALT-L SERIES END OF CIRCUIT LIGHT KIT

INSTALLATION INSTRUCTIONS


HLT PRODUCTS ALTERNATE STRIPPING METHOD

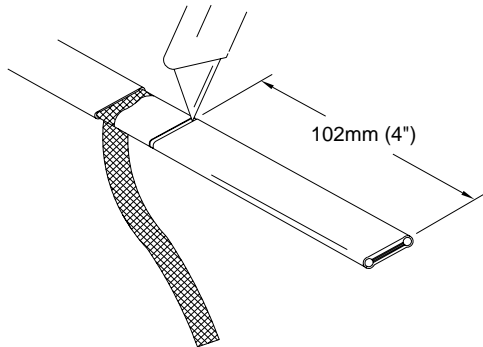


- ❶ Lightly cut around cable outer jacket 102mm (4") from the end. Bend cable to break outer jacket.
- ❷ Lightly cut the outer jacket up the center between the first cut mark & the cable end. Bend cable to break outer jacket.

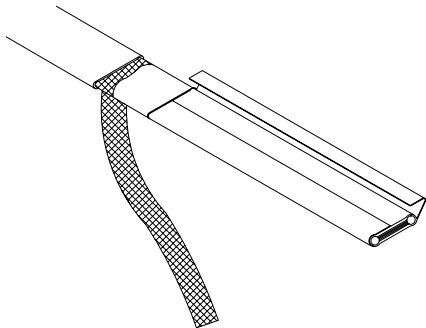


- ❸ Remove the jacket from the heater cable.

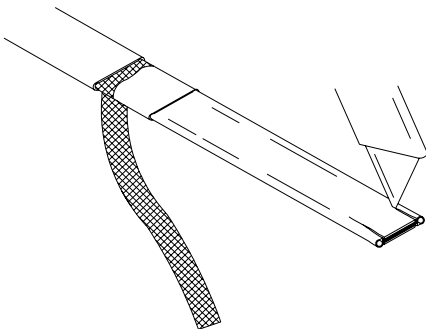


- ❹ Make a cut inside each bus wire.

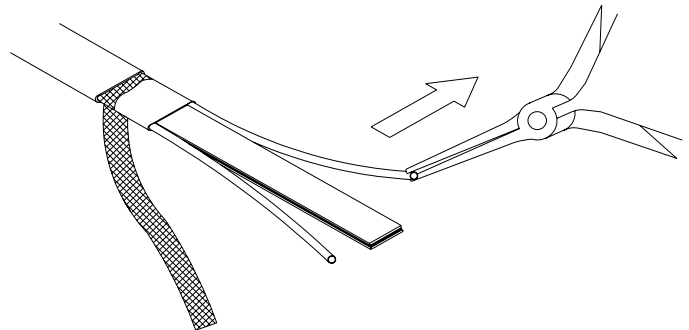

- ❺ Starting at the end, in the same plane as the cable, pull each bus wire away from the core material.

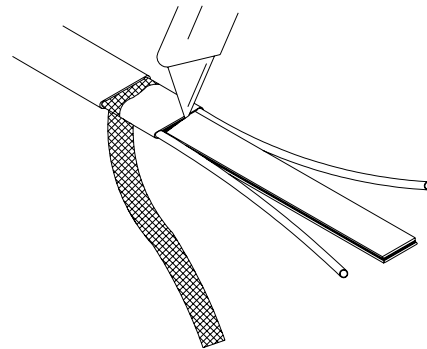

- ❻ Remove the exposed core material.

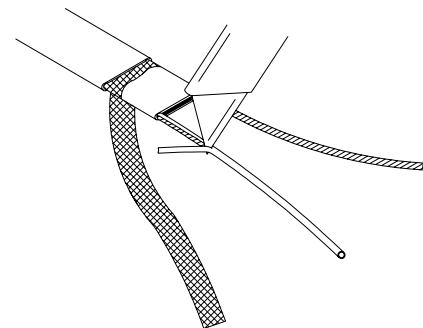


- ❼ Remove the remaining core material off the outside of each bus wire.
- ❽ Cut 6mm (0.25") off the end of each bus wire.
- ❾ Proceed to "Power Termination", sheet 7.

POWER TERMINATION




WARNING:

Bus wires must not touch or cross while inserting into power termination.

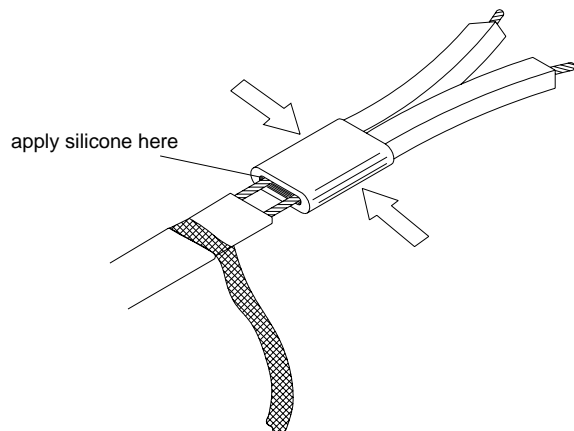

- ❶ Insert bus wires into power termination.
- ❷ Squeeze power termination opening and fill with silicone.

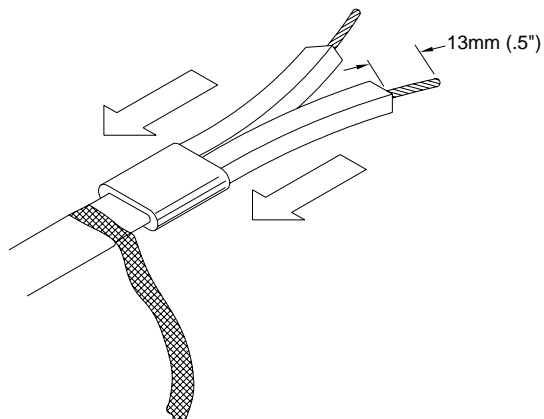


- ❸ Push power termination to overlap jacket.
- ❹ The silicone will set up in about 30 minutes with a complete cure after 24 hours.
- ❺ Proceed to "Electrical Connection", sheet 8.

NELSON™ HEAT TRACING SYSTEMS

ALT-L SERIES END OF CIRCUIT LIGHT KIT

INSTALLATION INSTRUCTIONS

ELECTRICAL CONNECTION

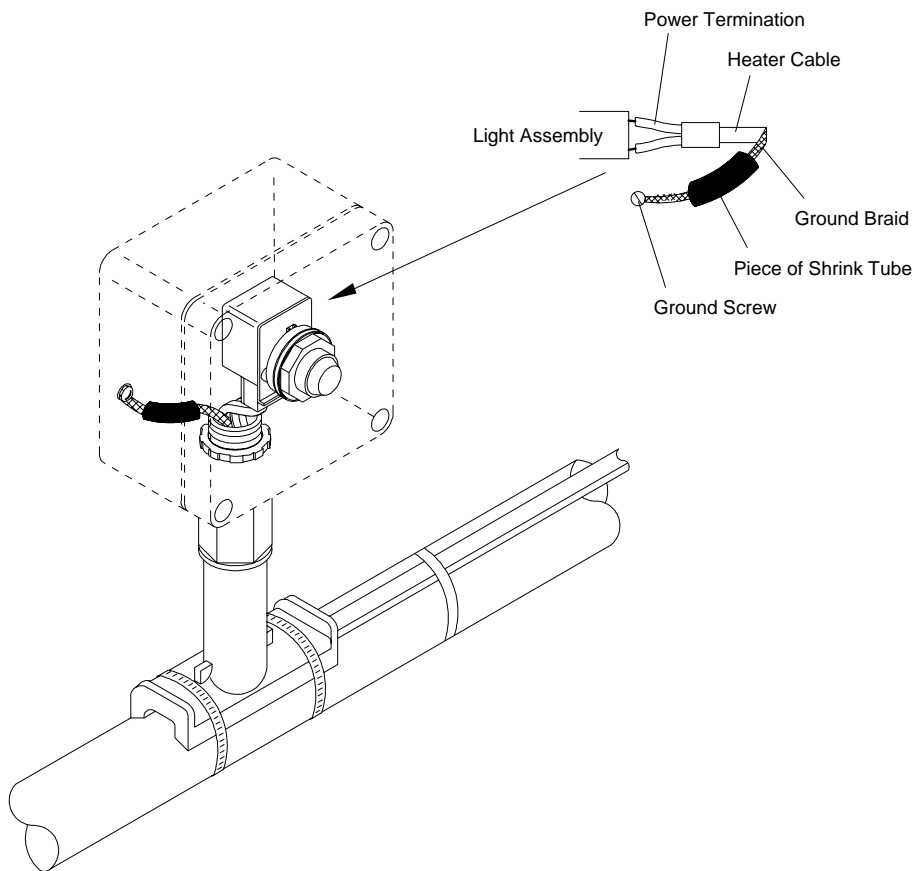

Note: This detail shows internal grounding of braid.

- ❶ Place gasket onto the box adapter.
- ❷ Position junction box onto the box adapter and secure it with the conduit locknut.
- ❸ Place the two black compensating gaskets onto the light assembly base.
- ❹ Insert power wires into screw connection of light assembly.
- ❺ Slide piece of shrink tube over ground braid.
- ❻ Connect ground braid to the ground screw inside the junction box. **See diagram above.**
- ❼ Place the box cover onto the light assembly then install the clear trim washer and secure it with the ring nut.
- ❽ Secure the box cover onto the junction box.

Nelson Heat Tracing Systems products are supplied with a limited warranty. Complete Terms and Conditions may be found on Nelson's website at www.nelsonheaters.com.